

# Utsläpp av hexen i samband med avlastning

Start datum:20010823

Händelse kod. BE/2001/002-[01]

## Kort rapport

### Typ av händelse

En lagringstank var överfyld när den lastades av fartyg. Ungefär 60 ton hexen släpptes ut. Den hexen som funnits i tanken täcktes omedelbart med skum för att hindra antändningen.

### Inblandade ämnen

Hexen (CAS nr: 592-41-6)  
Mängd: 60 ton släpptes ut

### Olycksobjekt

Avlastning av 500 ton av hexen från fartyg till lagringstank.

### Olycksorsak

- Administrativ kontroll av tom rymd i lagringstank avbröts på grund av fel i den specifika gravitation vilken används för tankberäkning.
- Detta kontrolleras inte på tanken innan den lastades. Som konsekvens släpptes 500 ton ut, men det fanns bara plats för 170 ton tillgängligt.
- Larmsignalen funkade inte på grund av ett tekniskt fel när man bytte detektionsanordning två år tidigare.

### Skador

Ingen kom till skada.  
Material hölls i tanken och pumpades in i separat lagringstank.

### Akutåtgärder

Fabriken evakuerades omedelbart.  
Ett skumskikt lades över hexen.

### Erfarenheter

- Lägg till fysisk kontroll av tomt utrymme i lagringstank till transportprocedurerna.
- Komplett kontroll av alla larm.
- Schemalagt preventiv reparation på hög-nivå larm.
- Revidera att ändra procedurerna.

## English summary

Start date: 23/08/2001

Accident code: BE/2001/002-[01]

## Accident type(s)

A storage tank was overfilled when discharging a ship. About 60 tons of hexene were released. The hexene was contained in the tank bund and immediately covered with foam to prevent ignition and odour problems.

### **Substance(s) directly involved**

Hexene (C.A.S. No: 592-41-6): 60 tons released

### **Immediate source(s) of accident**

Discharging of 500 tons of hexene from ship to storage tank

### **Suspected cause(s)**

- Administrative control of free space in storage tank failed due to a mistake in the specific gravity, which was used for the tank calculation module. There was no check on the tank itself before unloading. As a consequence 500 tons to be discharged, but only room for 170 tons available.
- High-level alarm did not function due to a technical error when changing the detection device some two years earlier.

### **Immediate effects**

No injuries.

Materials were contained in tank bund and pumped into a separate storage tank.

### **Emergency measures taken**

Plant was immediately evacuated.

External fire services used foam (available on site) to put a foam layer over the hexene.

### **Immediate lessons learned**

- Incorporate physical check of free space in storage tank into transfer procedures.
- Complete check of all high-level alarms
- Schedule preventive maintenance on all high-level alarms.
- Revise management of change procedures.