

# Utsläpp av svaveldioxid från kemikaliefabrik

Start datum: 990705

Händelse kod: ES/1999/001-(01)

## Kort rapport

### Typ av händelse

Svaveldioxid ( $\text{SO}_2$ ) släpptes ut på grund av en skenande reaktion; händelsen resulterade till att en mindre mängd av  $\text{SO}_2$  effektivt släpptes ut.

### Inblandade ämnen

Svaveldioxid ( $\text{SO}_2$ ) (CAS nr: 7446-09-5)  
Mängd involverade 11,4 Kg (0,0114 ton)

### Olyksobjekt

Vertikal cylindrisk reaktor, emaljerad inuti, kapacitet 71101, tryck 7,84 bar, utrustad med en mixer och en yttre mantel för temperaturkontroll. Lokaliserad i en sluten produktions sal med yttre ventilation.

### Olyksorsak

Mänsklig faktor: arbetaren lastade tional diklorid efter att felaktigt ha kontrollerat frånvaron av vatten. Vatten och tionaldiklorid fick komma i kontakt med varandra när mixer sattes på och en okontrollerad reaktion, bildade  $\text{SO}_2$ , skapade ett övertryck inuti reaktorn.

### Skador

Ingen personer kom till skada och ingen materiella skador förutom ersättande av skadade slang och spridning av liten mängd  $\text{SO}_2$  igenom ventilationsystemet i produktionssalen.

### Akutåtgärder

Befolkningen larmades.  
- evakuering av närlägen område  
- tillträde kontroll  
- aktivering av beredskapsplan.

### Erfarenheter

Att förbättra verifikations procedurer innan reaktorn startas.

## English summary

Start date: 05/07/1999

Accident code: ES/1999/001-(01)

### Accident type(s)

Sulphur dioxide (SO<sub>2</sub>) release due to a runaway reaction; the event resulted of minor gravity once the moment of SO<sub>2</sub> effectively released were know.

### **Substance(s) directly involved**

Sulphur dioxide (SO<sub>2</sub>) (C.A.S. No: 7446-09-05), amount involved: 11,4 Kg (0,0114 tonnes)

### **Immediate source(s) of accident**

Vertical cylindrical reactor, internally enamelled, capacity 7110 l, design pressure 7,84 bar, equipped with a mixer and an external jacket for temperature control. Located in a closed production hall with external ventilation.

### **Suspected cause(s)**

Human factor: the worker performed the loading operation with thionyl dichloride after checking erroneously the absence of water. Water and thionyl dichloride got into contact when the mixer was switched on and an uncontrolled reaction, forming SO<sub>2</sub>, built up an overpressure inside the reactor.

### **Immediate effects**

There was no damage to persons or material loss, except the substitution of the damaged joint and the dispersion of a small quantity of SO<sub>2</sub> through the ventilation system of the production hall.

### **Emergency measures taken**

- Alert to the population
- Evacuation of the nearby area
- Access control
- Activation of the on-site emergency plan

### **Immediate lessons learned**

- Improvement of the verification procedures before charging the reactors..